


Model 461995

Laser Photo / Contact Tachometer

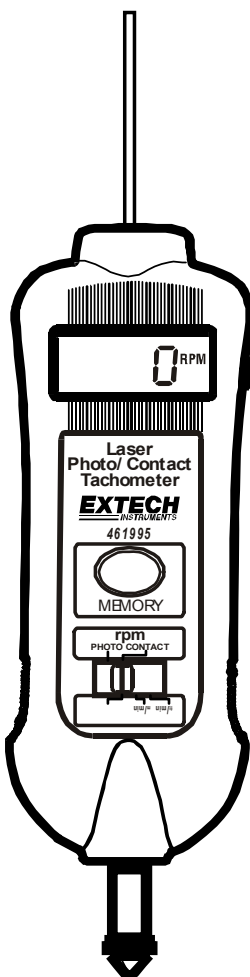

Introduction

Congratulations on your purchase of Extech's Laser Photo/Contact Tachometer, Model 461995. This Tachometer provides contact/non-contact RPM and Linear Surface Speed measurements. The laser pointer beam provides accurate long distance measurements for photo tachometer measurements. This meter, with proper care, will provide years of safe reliable service.

Safety



CAUTION




Laser Radiation



1. Use extreme caution when the laser beam is on
2. Do not point the beam toward anyone's eye
3. Be careful not to let the beam strike the eye from a reflective surface
4. Do not use the laser near explosive gases or in other potentially explosive areas

Meter Description

1. Photo Tachometer sensor and laser source
2. LCD display
3. MEMORY button
4. Function switch
5. Contact tachometer rotating ring
6. MEASURE button
7. Battery compartment (rear)

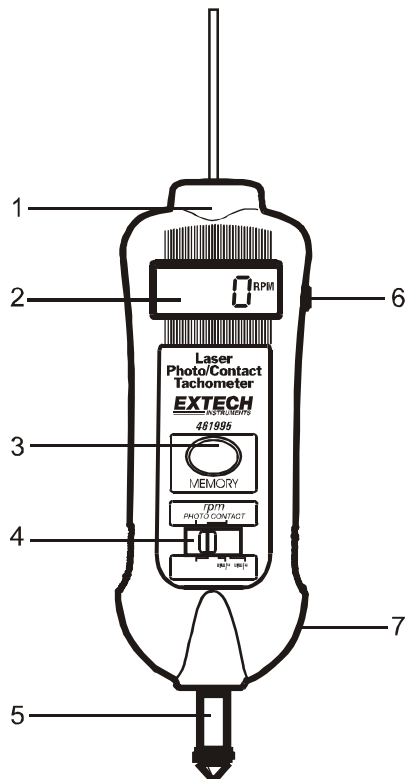

Meter Operation

Reversible LCD Display


The 461995 LCD display indicates Photo Tachometer measurements in one direction and Contact measurements in the opposite direction. This permits the user to easily read the measurement digits in both measurement modes with the meter held in either direction.

Photo Tachometer Measurements (refer to diagram below)

1. Apply an appropriately sized square piece of reflective tape to the surface of the object under test.
2. Move the Function switch to the PHOTO position.
3. Point the laser pointer end of the meter toward the device under test at a distance of 2" to 79" (50 to 2000mm).
4. Press the Measure button (located on the right side of the meter) and align the laser pointer beam with the reflective tape.
5. Verify that the Monitor Indicator appears on the upper left hand section of the LCD when the object under test passes through the light beam.
6. Release the Measure button when the RPM reading stabilizes on the LCD.
7. If the rpm is under 50, apply additional squares of reflective tape. Divide the reading shown on the display by the number of pieces of reflective tape squares to calculate the actual rpm.

NOTE: Bright ambient light may interfere with the reflected light beam. Shading the target area may be necessary in some cases.

CAUTION: Rotating objects can be dangerous. Use extreme care.

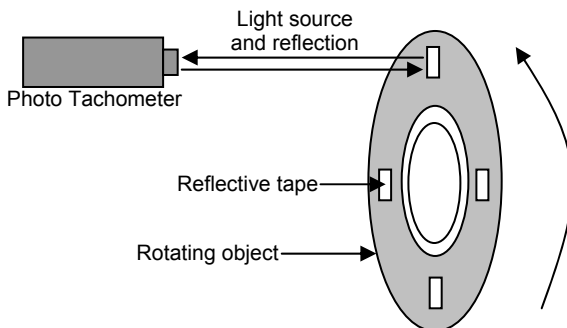

Contact Tachometer RPM Measurements

1. Move the Function switch to the CONTACT position.
2. Press the Measure button while lightly pressing the rotating ring against the center opening of a rotating shaft.
3. Release the Measure button when the display stabilizes (approx. 2 seconds).

Linear Surface Speed (ft/min or m/min) Measurements

1. Slide the Function Switch to "SURFACE SPEED ft/min" or "m/min" position.
2. Install the surface speed attachment on the meter rotating ring.
3. Press the Measure button and hold the surface speed wheel against the device being measured.
4. Release the Measure button when the display stabilizes (approx. 2 seconds).

MIN/MAX and Last Reading Memory Recall

The 461995 can record Maximum, Minimum, and Last Reading for the period of time the Measure button is held. These stored values can then be read directly on the meter's display. The memory will automatically clear after approximately 10 seconds of meter inactivity. Access the memory data immediately after the measurements have been taken as follows:

1. Press the Memory key once and hold it down: The Last Reading is displayed followed by the "LA" icon.
2. Press again and hold: The Maximum value is displayed followed by the "UP" icon
3. Press again and hold: The Minimum value is displayed followed by the "dn" icon

Battery Replacement

The low battery indication appears as "LO" on the display. To replace the batteries, slide the rear battery compartment cover off of the meter, replace the four 1.5V AA batteries, and replace cover.

Specifications

General Specifications

Circuit	Custom one-chip LSI microprocessor circuit
Time base	Quartz crystal 4.194 MHz
Display	Reversible 5 digit 0.4" (10mm) LCD display
Laser light source	Less than 1mW; Class 2 red laser diode (645nm approx.)
Detecting Distance	2 to 79" (50 to 2000 mm) depending on ambient light and RPM
Memory	Last reading and MIN/MAX readings
Operating Conditions	32 °F to 122 °F (0 °C to 50 °C); RH 80% Max
Power Supply	4 x 1.5 V AA batteries
Power Consumption	20mA DC approx.
Weight	10.6oz. (300g) including battery)
Size	8.5 x 2.6 x 1.5" (210 x 67 x 38 mm)
Accessories	(4)1.5V batteries, reflective tape 24" [600mm], surface speed/rpm rotating attachments, and carrying case

Range Specifications

	Range	Resolution	Accuracy (%rdg)
Photo Tachometer	10 to 99,999 rpm	0.1 rpm (<1000rpm) 1 rpm (>1000 rpm)	± (0.05% + 1d)
Contact Tachometer	0.5 to 19,999 rpm	0.1 rpm (<1000rpm) 1 rpm (>1000 rpm)	
Surface Speed	0.2 to 6560 ft/min	0.1 ft/min (<1000ft/min) 1 ft/min (>1000ft/min)	± (1% + 1d)
Surface Speed	0.05 to 1999.9 m/min	0.01 m/min (<100m/min) 0.1 m/min (>100 m/min)	

Warranty

FLIR Systems, Inc. warrants this Extech Instruments brand device to be free of defects in parts and workmanship for one year from date of shipment (a six month limited warranty applies to sensors and cables). If it should become necessary to return the instrument for service during or beyond the warranty period, contact the Customer Service Department for authorization. Visit the website www.extech.com for contact information. A Return Authorization (RA) number must be issued before any product is returned. The sender is responsible for shipping charges, freight, insurance and proper packaging to prevent damage in transit. This warranty does not apply to defects resulting from action of the user such as misuse, improper wiring, operation outside of specification, improper maintenance or repair, or unauthorized modification. FLIR Systems, Inc. specifically disclaims any implied warranties or merchantability or fitness for a specific purpose and will not be liable for any direct, indirect, incidental or consequential damages. FLIR's total liability is limited to repair or replacement of the product. The warranty set forth above is inclusive and no other warranty, whether written or oral, is expressed or implied.

Calibration, Repair, and Customer Care Services

FLIR Systems, Inc. offers repair and calibration services for the Extech Instruments products we sell. NIST certification for most products is also provided. Call the Customer Service Department for information on calibration services available for this product. Annual calibrations should be performed to verify meter performance and accuracy. Technical support and general customer service is also provided, refer to the contact information provided below.

Support Lines: U.S. (877) 439-8324; International: +1 (603) 324-7800

Technical Support: Option 3; E-mail: support@extech.com

Repair & Returns: Option 4; E-mail: repair@extech.com

Product specifications are subject to change without notice

Please visit our website for the most up-to-date information

www.extech.com

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

ISO 9001 Certified

Copyright © 2013 FLIR Systems, Inc.

All rights reserved including the right of reproduction in whole or in part in any form

www.extech.com

Garantie

FLIR Systems, Inc. garantit que cet appareil Extech Instruments est exempt de défauts matériaux et de fabrication pendant un an à partir de la date d'envoi (une garantie limitée de six mois s'applique aux capteurs et aux câbles). Si le renvoi de l'appareil pour réparation devient nécessaire durant ou après la période de garantie, contactez le service client pour autorisation. Pour obtenir les coordonnées, visitez le site Web suivant : www.extech.com. Un numéro d'autorisation de retour (AR) doit être délivré avant tout retour de produit. L'expéditeur prend à sa charge les frais d'expédition, le fret, l'assurance et l'emballage correct de l'appareil afin de prévenir toute détérioration durant le transport. Cette garantie ne s'applique pas aux dommages imputables à l'utilisateur, tels que l'usage impropre ou abusif, un mauvais câblage, une utilisation non conforme aux spécifications, un entretien ou une réparation incorrecte, ou toute modification non autorisée. FLIR Systems, Inc. déclinera spécifiquement toute garantie ou qualité marchande ou aptitude à l'emploi prévu, et ne sera en aucun cas tenu responsable pour tout dommage conséquent, direct, indirect ou accidentel. La responsabilité totale de FLIR est limitée à la réparation ou au remplacement du produit. La garantie définie ci-dessus est inclusive et aucune autre garantie, écrite ou orale, n'est exprimée ou implicite.

Calibrage, réparation et services après-vente

FLIR Systems, Inc. offre des services de calibrage et de réparation pour les produits Extech Instruments que nous commercialisons. Nous fournissons également une certification NIST pour la plupart des produits. Contactez notre service client pour toute information sur les services de calibrage disponibles pour ce produit. Un calibrage doit être effectué chaque année pour vérifier les performances et la précision du mètre. Nous offrons également une assistance technique et un service à la clientèle. Veuillez vous reporter aux coordonnées fournies ci-dessous.

Lignes d'assistance: États-Unis (877) 439-8324; international: +1 (603) 324-7800

Service d'assistance technique : Option 3 ; E-mail : support@extech.com

Réparations et retours : Option 4 ; E-mail : repair@extech.com

Les spécifications produit sont sujettes à modifications sans préavis.

Pour les toutes dernières informations, veuillez visiter notre site Web.

www.extech.com

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

Certifié ISO 9001

Copyright © 2013 FLIR Systems, Inc.

Tous droits réservés, y compris la reproduction partielle ou totale sous quelque forme que ce soit.

www.extech.com

Garantía

FLIR Systems, Inc., garantiza este dispositivo marca Extech Instruments para estar libre de defectos en partes o mano de obra durante un año a partir de la fecha de embarque (se aplica una garantía limitada de seis meses para cables y sensores). Si fuera necesario regresar el instrumento para servicio durante o después del periodo de garantía, llame al Departamento de Servicio a Clientes para obtener autorización. Visite www.extech.com para Información de contacto. Se debe expedir un número de Autorización de Devolución (AD) antes de regresar cualquier producto. El remitente es responsable de los gastos de embarque, flete, seguro y empaque apropiado para prevenir daños en tránsito. Esta garantía no se aplica a defectos resultantes de las acciones del usuario como el mal uso, alambrado equivocado, operación fuera de las especificaciones, mantenimiento o reparación inadecuada o modificación no autorizada. FLIR Systems, Inc., rechaza específicamente cualesquier garantías implícitas o factibilidad de comercialización o idoneidad para cualquier propósito determinado y no será responsable por cualesquier daños directos, indirectos, incidentales o consecuentes. La responsabilidad total de FLIR está limitada a la reparación o reemplazo del producto. La garantía precedente es inclusiva y no hay otra garantía ya sea escrita u oral, expresa o implícita.

Servicios de calibración, reparación y atención a clientes

FLIR Systems, Inc., ofrece servicios de reparación y calibración para los productos que vendemos de Extech Instruments. Además ofrecemos certificación NIST para la mayoría de los productos. Llame al Departamento de Servicio al Cliente para solicitar información de calibración para este producto. Para verificar el funcionamiento y precisión se debe realizar la calibración anual. Además se provee Soporte Técnico y servicios generales al cliente, consulte la información de contacto en seguida.

Líneas de soporte: EE.UU. (877) 439-8324; Internacional: +1 (603) 324-7800

Soporte Técnico Opción 3; correo electrónico: support@extech.com

Reparación / Devoluciones: Opción 4; correo electrónico: repair@extech.com

Las especificaciones del producto están sujetas a cambios sin aviso

Por favor visite nuestra página en Internet para la información más actualizada

www.extech.com

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

Certificado ISO 9001

Copyright © 2013 FLIR Systems, Inc.

Reservados todos los derechos, incluyendo el derecho de reproducción total o parcial en cualquier medio

www.extech.com