

# PicoScope<sup>®</sup>

THREE-AXIS ACCELEROMETER

# Vibration and Acceleration

Three-axis accelerometer and interface included Simply plugs into any PicoScope oscilloscope

± 5 g measurement range



Designed for use with PicoScope oscilloscopes, compatible with most other oscilloscopes and data loggers

#### **Connections**


BNC connections to the oscilloscope or data logger

pico

6 pin DIN plug for accelerometer connection

## PicoScope 6 software

It is easy to see the output of your three-axis accelerometer by connecting it to a PicoScope oscilloscope and opening our PicoScope 6 software.

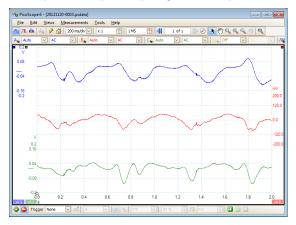

#### Kit contents

The PicoScope Three-Axis Accelerometer kit contains the following items:

- 1 x Accelerometer sensor
- 1 x Mounting magnet
- 1 x Sensor Interface
- 3 x BNC cables
- 1 x Quick Start Guide

### **Specifications**

	,
Weight (Interface/Vibration Sensor)	120 g / 80 g
Dimensions Sensor Interface (inc. BNCs) Magnet (inc. fitted grub screw)	105 mm × 65 mm × 27 mm 12 mm × ø18 mm
Battery (Lithium Primary Cell)	CR123(A) 3 V
Battery life (Shelf/Vibration mode)	10 years / 6 months
Maximum measurable acceleration	±5 g
Output BNC	0-2 V DC coupled
Vibration frequency (3 dB)	DC to 350 Hz
BNC overvoltage protection	30 V
Shock survivability (sensor head)	10,000 g
Temperature range (operating) Sensor head	-40 °C to 85 °C
Thread mounting (sensor)	1/4" × 28 UNF
EMC approvals	CE: Meets EN61326-1:2006
Output scaling	99 to 122 mV/g
0 g output (all axes)	0.85 to 1.15 V

## Ordering information

ORDER CODE	DESCRIPTION
PP877	Three-Axis Accelerometer Kit

# www.picotech.com

Pico Technology James House Colmworth Business Park ST. NEOTS PE19 8YP United Kingdom +44 (0) 1480 396395 +44 (0) 1480 396296

sales@picotech.com



