

**New**



Rated at 500A rms


Wide bandwidth

Super high precision

AC/DC CURRENT SENSOR  
CT6862, CT6863

## POWER HiTESTER 3193

Power measuring instruments

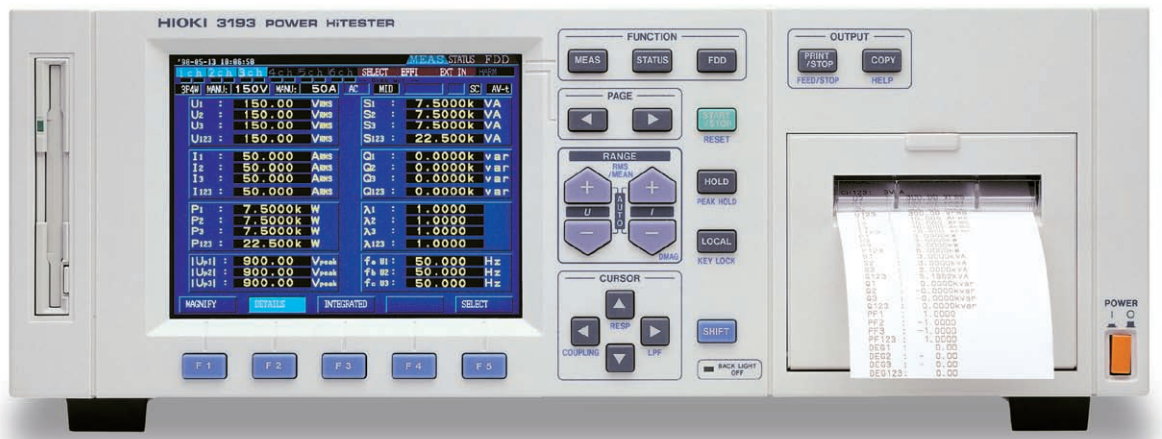

Printer is optional unit

DC/0.5Hz to 1MHz broad-band POWER HiTESTER measures up to 6 systems simultaneously.

# Wide Spectrum Power Meter for Comprehensive Device Assessment

### MOTOR / HARMONIC HiTESTER 3194



MOTOR / HARMONIC HiTESTER 3194 provides analysis of high-order harmonics up to the 3000th order. Additionally, with the optional EXTERNAL SIGNAL INPUT UNIT 9603-01 installed, the HiTESTER can directly measure torque and rotation speed, an essential feature for evaluating the performance of inverter motors. This makes it easy to construct measurement systems.

The POWER HiTESTER 3193 is a multi-function power meter for use with single phase power lines to 3-phase, 4-wire circuits. Accommodating up to 6 units, it is not only capable of measuring up to 6 single phase systems, but can simultaneously measure the input and output of a 3-phase inverter and provide effective power measurements. Additionally, it supports harmonic analysis and flicker measurement (optional), features which are essential for overall device assessment. Standard features include a GP-IB/RS-232C interface and 3.5-inch floppy disk drive, making it easy to feed data to a personal computer for processing and analysis. This unit is ideal for those requiring greater efficiency in electrical device assessment.



ISO 9001  
JMI-0216



ISO 14001  
JQA-E-90091



[www.hioki.com](http://www.hioki.com)

HIOKI company overview, new products, environmental considerations and other information are available on our website.

Broad coverage, high accuracy, and well-developed interface

# Complete with functions that answer all your power measurement needs.



## Features

### ■ Wide range of measurement functions

Capable of measuring voltage, current, active /reactive /apparent power, power factor, phase, frequency, and current, and of integrating power according to polarity, the 3193 (or 3194) also provides wave peak and efficiency measurements that are essential to device assessment.

### ■ Measure Motor Output

With the optional EXTERNAL SIGNAL INPUT UNIT 9603, the HiTESTER can take analog input in from torque and revolution measurements and use that information to calculate motor output.

### ■ Measurement for Minute Stand-by Power also Available (by special-order)

The 9600 and 9601 input units have 10-times improved current sensitivity, and currents starting from the 20.000mA range can be measured. (Please inquire for further information.)

### ■ High Visibility Color LCD

Featuring a wide viewing angle, the color LCD displays a variety of items simultaneously, making it ideal for quickly grasping power usage on the system being measured. Expanded display is possible for any four selected items.

Enlarged Indication	
U <sub>123</sub>	201.84 V <sub>RMS</sub>
I <sub>123</sub>	9.501 A <sub>RMS</sub>
P <sub>123</sub>	1.3683 kW
λ <sub>123</sub>	0.7135

### ■ Harmonic and Flicker Analysis

Harmonic and flicker analysis are possible when using the optional HARMONIC / FLICKER MEASUREMENTS UNIT 9605 (3193 only).

### ■ High Basic Accuracy of $\pm 0.2\%$

Measurements of even greater precision can be obtained using the optional 9600 to 9602 input unit, which provides a basic accuracy of  $\pm 0.1\%$  rdg,  $\pm 0.1\%$  f.s. (With the 9602, the accuracy of the clamp-on sensor is a factor affecting total accuracy during power measurement.)

### ■ A Variety of Interfaces for Differing Needs

#### ★ Connecting to a PC

The 3.5 inch floppy disk drive and RS-232C / GP-IB interface, provided as standard features, make it possible to connect the power meter directly to a PC, allowing efficient measurement, management and analysis of data.



#### ★ Connecting to a Recorder

With 8 selectable D/A outputs and voltage, current and power analog/monitor output (current and voltage only) as standard features, the HiTESTER allows recording of changes and transient fluctuations in waveforms using a recording unit.



#### ★ Connecting to a Printer

Data can be output to the optional PRINTER UNIT 9604.



Print type : Thermal line dot printing  
Paper width : 72mm  
Main functions


: printing of items measured, hard copy output of displayed screens, printout of meter settings, printout of various times (such as interval time, timer time, and realtime control time). Printouts are performed either automatically, upon input of an external control signal, or synchronized with an integrator.



# Other Analysis Functions


## Integration According to Polarity

Positive, negative, and total current and power can be integrated simultaneously for all channels. This makes it possible to grasp the income and outflow of power at a glance.

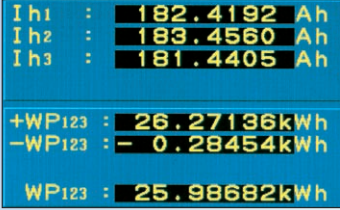

## Analog and D/A Output


Analog (voltage, current, and effective power) and D/A outputs (any selected eight items) are output as a 5V range full scale value. (Except for the 1000V range), 100ms response time can be obtained by using the FAST setting.

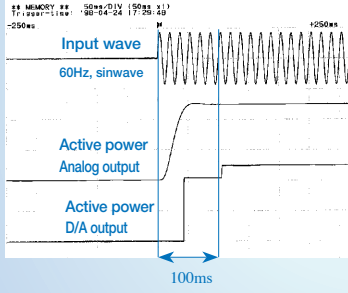

- **3 Types of Averaging Functions**  
Select from time average, moving average and exponential average.
- **3ch Frequency Measurement Function**  
With the frequency ranges, LPF and HPF can be used in combination, allowing measurement of fundamental waveforms and carrier waveforms of inverters.
- **Efficiency Calculation Function**  
Three efficiency calculations can be obtained simultaneously from measured voltage values.


## Peak Measurements Function

Voltage and current wave peaks can be measured. The Peak Hold function can be used to find peak values and effective maximums for motor rush current waves.

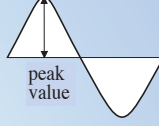

## Wave Monitor Output

With the voltage and current ranges, waveforms are output as 1V full scale values, allowing waveforms to be monitored using devices such as recorders or synchroscopes.

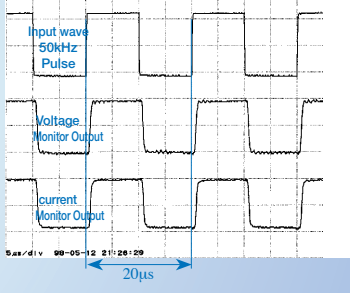

- **3 Types of Built-in Low Pass Filters**  
Selectable cutoff frequencies (500/5k/300kHz) allow extraction of the frequency component of fundamental inverter waveforms and provide data compatibility with previous instruments.
- **Choose from Three Types of Calculation Algorithms**  
Three selectable algorithms are provided for calculating apparent power and reactive power, providing compatibility with previous devices

### Choose from a variety of input units according to application

Three types of input units are available, including the 9602 AC/DC Clamp Input Unit, which can be used with current levels exceeding 50A under live circuit conditions, as well as the 9600 and 9601 which accept direct input of up to 1000V/50A.


- **9600** . . . DC/0.5Hz to 1MHz wide band
- **9601** . . . 5Hz to 100kHz, for AC only
- **9602** . . . DC/0.5Hz to 200kHz clamp input

Choose from a variety of sensors including AC Clamp On Sensors 9272-10 and 9290-10, AC/DC Clamp On Sensors 9277, 9278 and 9279, and super high-precision AC/DC Sensors 9709, CT6862 and CT6863.


1ch	2ch	3ch	4ch	5ch	6ch
1 φ 2 W	1 φ 2 W	1 φ 2 W	1 φ 2 W	1 φ 2 W	1 φ 2 W
1 φ 3 W / 3 φ 3 W	1 φ 2 W	1 φ 2 W	1 φ 2 W	1 φ 2 W	1 φ 2 W
1 φ 3 W / 3 φ 3 W	1 φ 3 W / 3 φ 3 W	1 φ 2 W	1 φ 2 W	1 φ 2 W	1 φ 2 W
1 φ 3 W / 3 φ 3 W	1 φ 3 W / 3 φ 3 W	1 φ 3 W / 3 φ 3 W	1 φ 2 W	1 φ 2 W	1 φ 2 W
3V3A (3 φ 3W) / 3 φ 4W			1 φ 2 W	1 φ 2 W	1 φ 2 W
3V3A (3 φ 3W) / 3 φ 4W			1 φ 3 W / 3 φ 3 W		1 φ 2 W
3V3A (3 φ 3W) / 3 φ 4W			3V3A (3 φ 3W) / 3 φ 4W		

### Simultaneous Measurement of Multiple Systems


Since all units are mutually isolated, the primary and secondary sides of devices or disparate power lines can be measured simultaneously. Simultaneous measurement of single phase 6 wire or 3 phase 2 wire systems which previously required multiple units, can now be handled with one. What's more, measurements of all devices can be taken at the same instant, providing a powerful tool for integrated, all-round device assessment.

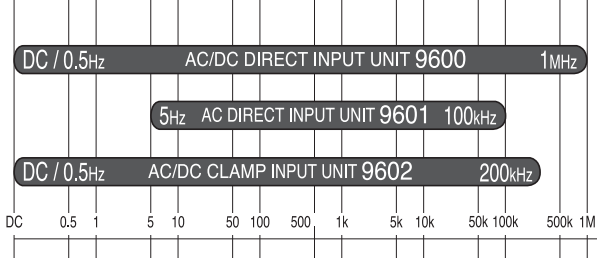

9600 Frequency characteristics (at 15V[15V×1A] range, response slow)

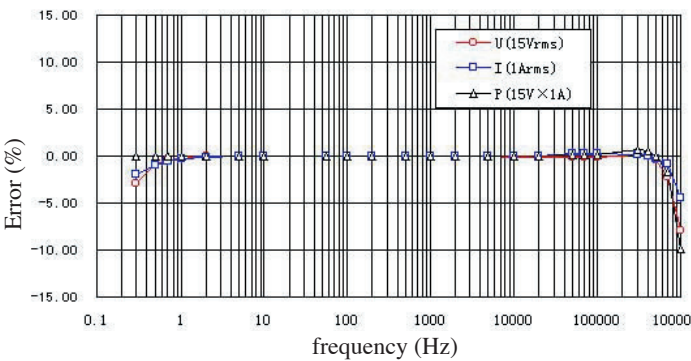

Effect of common mode voltage

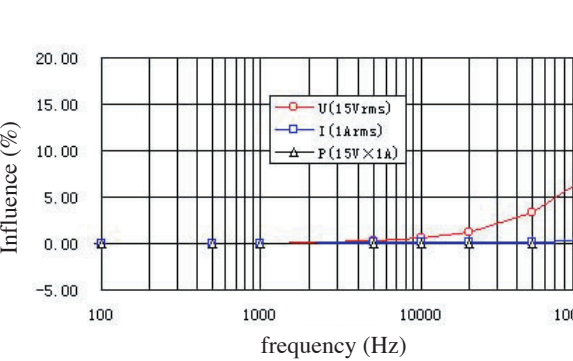


Measure all items at same point in time

# The Power Analysis Station


## Applications of 3193

### Example of Application With Power Converter

Measure mixed AC and DC components with a single unit.




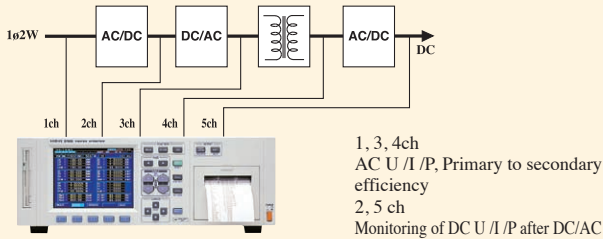


### Example of Assessment Trial of EV ( Electric Vehicle)

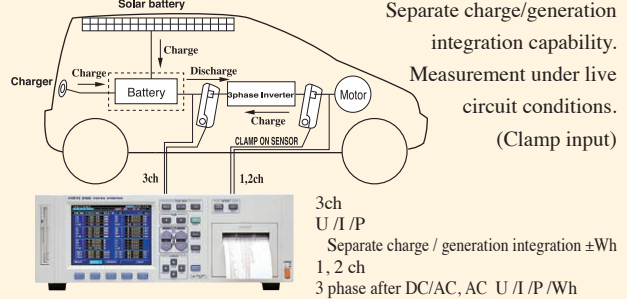

## 3194 Performs Comprehensive Evaluation of 3-phase Inverter Motors

Capable of measuring carrier frequencies on the secondary side of inverters. Also allows analysis to be synchronized with motor rotation.

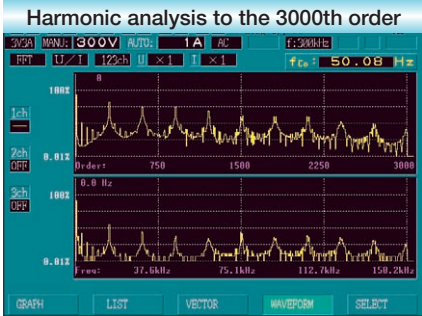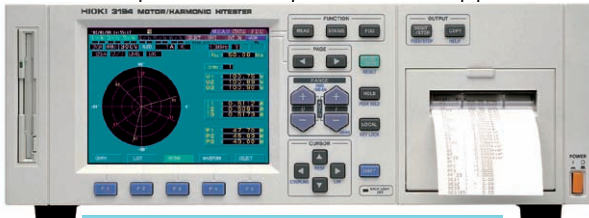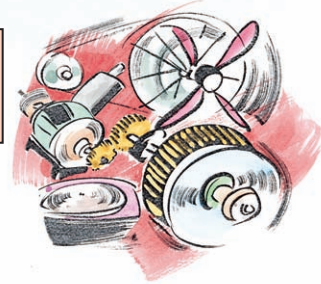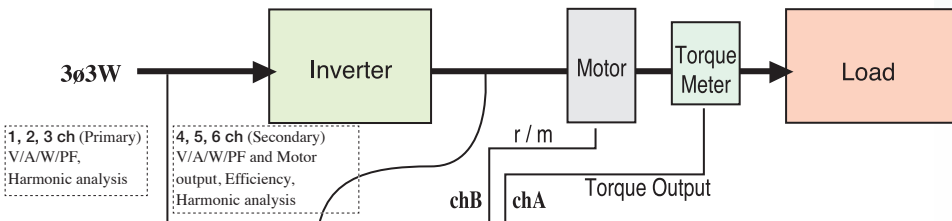

### 9603-01 Specifications

Torque, rotation speed, and motor power can be measured by inputting analog torque and r/m signals to the **EXTERNAL INPUT UNIT 9603-01**. Further, an input terminal is provided for use with a strain gauge-type torque sensor.

**9603-01 EXTERNAL INPUT UNIT**

**Input channels** : 2 channels  
**Ch A** : Strain gauge sensor or DC voltage input (BNC)  
**Ch B** : Pulse or DC voltage input (BNC)

**Strain gauge input specifications (dedicated connector)**  
**Applicable converter** : Strain gauge type converter (bridge resistance 350Ω - 1.5kΩ)  
**Measurement range** : 1 mV/V / 1.5 mV/V / 2 mV/V  
**Measurement accuracy** : ±0.1%rdg, ±0.065%f.s.  
**Connector** : PRC03-23A10-7F (manufactured by Tajimi)

**DC voltage input specifications (ch A / ch B common BNC connector)**  
**Input resistance** : 200kΩ ±5% (differential)  
**Measurement range** : ±1.0000 / ±5.0000 / ±10.000V  
**Measurement accuracy** : ±0.1%rdg, ±0.1%f.s. (23°C ±5°C, not higher than 80%rh)

**Pulse input specifications (ch B, BNC connector)**  
**Frequency measurement** : 1Hz to 100 kHz

**Common specifications**  
**Analog output** : ±5V f.s. (Output accuracy : Measurement accuracy ±0.2%f.s.)

### 3194 Specifications (Harmonic Waveform Analysis Function)

- Measurement lines** : Single-phase 2- and 3- wire, three-phase 3- and 4-wire
- No. of channels** : Up to 3 channels from channels 1 to 6
- Measurement range** : Fundamental frequency: 10 Hz to 4.5 kHz

### Harmonic Waveform Analysis Functions

- Measurement method** : PLL or external clock
- A/D resolution** : 12 bits
- Windowing type** : Rectangular tiling (with gap between windows)
- Crest factor** : Up to 2.5 (voltage, current)
- PLL source** : U, I or external synchronization
- Ext. synchronization signal** : Input to a rear panel control terminal on the 3194 main unit  
Input level: 1V to 10 Vrms. Division function: 1/1 to 1/255
- Measurement items** : RMS voltage, RMS current, effective power value, frequency, ±U peak, ±I peak
- Harmonic wave measurement items** : Harmonic level, percentage and phase angle of harmonic wave, Total harmonic distortion (THD-F, THD-R)
- Screen displays** : List, graph, vector and waveform displays
- Wiring conversion** : Δ-Y voltage conversion, Y-Δ voltage conversion
- Sort function** : Sorts according to decreasing order of analysis, displays up to 50th order
- Averaging function** : Index average with time constant of 1.5 sec
- Frequency ranges** :

	Fundamental Frequency	Sampling speed (Hz)	Window Width	Analysis Order
PLL Synchronization Ranges	10 - 17.5 Hz	f × 8192	1 waveform	3000 (10kHz or less)
	17.5 - 35 Hz	f × 8192	1 waveform	3000 (10kHz or less)
	35 - 70 Hz	f × 8192	1 waveform	3000 (100kHz or less)
	70 - 140 Hz	f × 4096	2 waveforms	1500 (100kHz or less)
	140 - 280 Hz	f × 2048	4 waveforms	800 (100kHz or less)
	280 - 560 Hz	f × 1024	8 waveforms	400 (100kHz or less)
	560 - 1120 Hz	f × 512	16 waveforms	200 (100kHz or less)
Fixed clock	1120 - 2240 Hz	f × 256	32 waveforms	100 (100kHz or less)
	2240 - 4500 Hz	f × 128	64 waveforms	50 (100kHz or less)
	---	50 × 8192 Fixed	2 waveforms	3000 (100kHz or less)

Note 1: Analysis order accuracy is restricted to the frequency in parentheses.  
 Note 2: With PLL synchronization in the range of 10 to 35 Hz, an anti-aliasing filter of about 15 kHz is used, and with PLL synchronization in the range of 35 Hz to 4.5kHz, an anti-aliasing filter of about 120 kHz is used.




# Applications of Model 3193

Even Supports Harmonic / Flicker analysis when using the optional 9605 HARMONIC / FLICKER MEASUREMENTS UNIT .

## Graph Display of Harmonics

Voltage, current and power can be analyzed and displayed by bargraphs of harmonic amplitude, content and phase angle. Voltage, current and power can be displayed simultaneously for a single channel, or a single parameter can be displayed simultaneously for each of three channels.

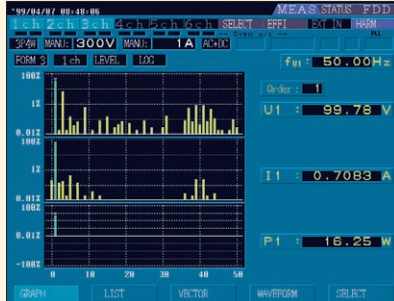

## List Display of Harmonics

The harmonic list display shows the amplitude, proportion, phase angle and distortion for each harmonic of voltage, current and power. Displaying only proportion, or two parameters simultaneously, such as amplitude and phase angle, is selectable.




## Vector Display of Harmonics

The harmonic vector display shows the voltage, current and phase angle for each harmonic, making clear the voltage-current phase relationship.



## Waveform Display

The waveform display shows one cycle of the voltage and current waveforms. RMS and peak values can be displayed along with voltage and current waveforms, or voltage and current waveforms for up to three channels can be displayed at the same time.

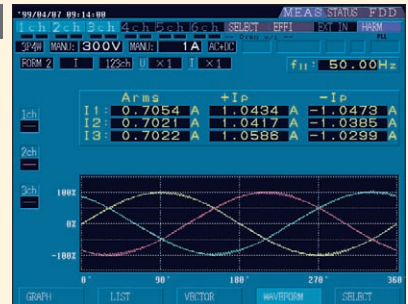


## Flicker Measurement Display

Displays data during measurement in real-time. Display can also be switched to D measurement and "Pst" value.



## Monitor Display

The relative "d" voltage change  $\Delta V/V$  and the instantaneous flicker value "S(t)" can be displayed in a time series, so past variations are clearly displayed.

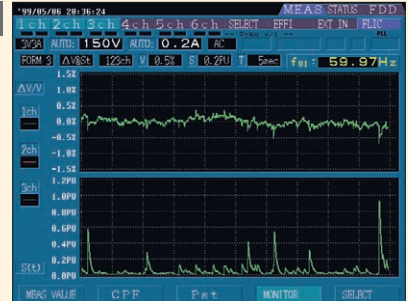

## 9605 Specifications (optional)

- Installation** : Installs in the 3193 main unit
- Measurement lines** : Single-phase 2- and 3-wire, three-phase 4-wire
- No. of channels** : Up to 3 channels within channels 1 to 6, depending on 3193 wiring mode
- Output functions** : Floppy disk, RS-232C, GP-IB, printer

### ● Harmonic Waveform Analysis Functions

- Measurement range** : Fundamental frequency: 1 to 440 Hz  
PLL system (5 to 440 Hz), external clock system (1 to 5 Hz)
- Orders analyzed** : Up to 50th harmonic (with 1 to 250 Hz fundamental)
- Window width** : 16 cycles (for 40 to 70 Hz fundamental)
- Windowing type** : Rectangular tiling (no gap between or overlap of windows)
- Amount of data analyzed** : 512 points (for 40 to 70 Hz fundamental)
- Crest factor** : Up to 4 (current), and up to 3 (voltage)
- Measurement items** : Harmonic level, percentage and phase angle of each order of harmonic wave for each of voltage, current and power. Total up to 50th harmonic (of 40 to 70 Hz fundamental) for voltage, current and power. Total harmonic distortion for voltage and current (THD-F and THD-R)  
Measurement of voltage, current, active power, peak voltage and peak current values of the fundamental

\*1. The 9605 does not support limit values, so pass/fail decisions based on limit values, classification of special waveforms (A to D) and 2.5-minute measurement function for measuring transient harmonic currents are not available.

- Update rate** : Every 1 window (except during communications with other devices)
- Screen displays** : List, graph, vector and waveform
- Accuracy**\*3 : Harmonic levels; at 45 to 66 Hz  
Voltage/current:  $\pm 0.5\% \text{rdg} \pm 0.05\% \text{f.s.}$   
Active power:  $\pm 1.0\% \text{rdg} \pm 0.1\% \text{f.s.}$   
For 45 to 66-Hz fundamental, effective input is 0.1 to 110% of range, total error of harmonic current when PLL is locked is 5% of the limit value or within 0.2% of the rated current of the device under test (no limitation with 9602).

### ● Flicker Measurement Function

- Measurement range** : Fundamental frequency; 45 to 66 Hz, PLL synchronization system
- Analysis items** : dc (relative constant voltage change), d max (max. relative constant voltage change), d(t)200ms (relative voltage change per time), P0.1/ P1s/ P3s/ P10s and 30s (cumulative probability), Pst (short-term flicker value), Plt (long-term flicker value)

- Screen displays** : Measured value, CPF, Pst list, Monitor
- Accuracy**\*3 : RMS voltage  $\pm 0.5\% \text{rdg} \pm 0.05\% \text{f.s.}$  (45Hz~66Hz)

\*2. Decision function not included.

\*3. The reading accuracy of the input unit must combined with the analysis accuracy shown above. When used with a clamp sensor, accuracy and frequency characteristics of the clamp must be added to the analysis accuracy above.

### Optional Input Unit Specifications

Customized versions of Models 9600 and 9601 are also available for stand-by power measurement with 10-times improved sensitivity for current ranges. Please ask for detailed specs.

	AC/DC DIRECT INPUT UNIT 9600			AC/DC CLAMP INPUT UNIT 9602		
	Voltage	Current	Active power	Voltage	Current	Active power
Measurement range	6.0000/15.000/30.000/ 60.000/150.00/300.00/ 600.00V/1.0000 kV	200.00/500.00mA/ 1.0000/2.0000/5.0000/ 10.000/20.000/50.000 A	Depends on combination of voltage and current ranges	6.0000/15.000/30.000/ 60.000/150.00/300.00/ 600.00V	500.00mA to 500.00A (Depends on clamp-on sensor)	Depends on combination of voltage and current ranges
Max. operating input <sub>(50Hz)</sub>	1000Vrms/1500 V peak	65Arms/100 A peak		650Vrms/850Vpeak	(Depends on clamp-on sensor)	
Crest factor	Lower of either (measured range X 6) / measured value or maximum permissible rated peak / measured value			Lower of either (measured range X 6) / measured value or maximum permissible rated peak/measured value		
Input resistance	2MΩ±5%	1mΩ max.		2MΩ±5%	200kΩ±5%	
Accuracy	(Accuracy assured at 23°C±5°C (73°F ±9°F) at 80% R.H., power factor = 1, sine wave input, in-phase voltage 0, after DMAG)					
DC	±0.1%rdg.±0.2%f.s.	←	←	±0.1%rdg.±0.2%f.s.	←	←
0.5 to 1Hz	±0.5%rdg.±0.5%f.s.	←	←	±0.5%rdg.±0.5%f.s.	←	←
1 to 10Hz	±0.2%rdg.±0.2%f.s.	←	←	±0.2%rdg.±0.2%f.s.	←	←
10 to 45Hz	±0.1%rdg.±0.2%f.s.	←	←	±0.1%rdg.±0.2%f.s.	←	←
45 to 66Hz	±0.1%rdg.±0.1%f.s.	←	←	±0.1%rdg.±0.1%f.s.	←	←
66Hz to 10kHz	±0.1%rdg.±0.2%f.s.	←	←	±0.1%rdg.±0.2%f.s.	←	←
10 k to 50kHz	±0.3%rdg.±0.3%f.s.	←	←	±0.5%rdg.±0.5%f.s.	←	←
		Less than 5 A Greater than 5 A	Less than 5 A Greater than 5 A			
50 k to 100kHz	±0.5%rdg.±0.5%f.s.	±0.5%rdg. ±0.5%f.s.	±2.5%f.s.	±0.5%rdg. ±0.5%f.s.	±5.0%f.s.	±0.3%rdg.±0.5%f.s.
100k to 300kHz	±0.5%rdg.±0.5%f.s.	±0.5%rdg. ±0.5%f.s.	±5%f.s.	±1.0%rdg. ±1.5%f.s.	±10.0%f.s.	±30%f.s.(up to 200kHz)
300k to 400kHz	±1.5%rdg.±0.5%f.s.	±1.0%rdg. ±0.5%f.s.		±1.0%rdg. ±2.5%f.s.		
400k to 500kHz	±2.0%rdg.±1.0%f.s.	±2.0%rdg. ±1.0%f.s.		±2.0%rdg. ±2.5%f.s.		
500k to 700kHz	±10.0%f.s.	±10.0%f.s.		±15.0%f.s.		
700k to 1 MHz	±15.0%f.s.	±15.0%f.s.		±30.0%f.s.		

■ Compatible Clamp (Optional)

9279 9709 CT6862 CT6863



9272-10 9277/9278

With the 9602, the accuracy of the clamp-on sensor is a factor affecting total accuracy during current measurement, as are phase and frequency characteristics. See page 7 for details on the clamp-on sensor specifications.

	AC DIRECT INPUT UNIT 9601		
	Voltage	Current	Active power
Measurement range	60.0000/150.00/300.00/6 00.00V/1.0000 kV	200.00/500.00mA/ 1.0000/2.0000/5.0000/ 10.000/20.000/50.000 A	Depends on combination of voltage and current ranges
Max. operating input <sub>(50Hz)</sub>	1000Vrms/1500 V peak	65Arms/100 A peak	
Crest factor	Lower of either (measured range X 6) / measured value or maximum permissible rated peak / measured value		
Input resistance	2MΩ±5%	1mΩ max.	
Accuracy (Accuracy assured at 23°C±5°C(73°F ±9°F) at 80% R.H., power factor = 1, sine wave input, in-phase voltage 0)			
5 to 10Hz	±2.5%f.s.	←	←
10 to 20Hz	±1.0%f.s.	←	←
20 to 45Hz	±0.1%rdg.±0.2%f.s.	←	←
45 to 66Hz	±0.1%rdg.±0.1%f.s.	←	←
66Hz to 5kHz	±0.1%rdg.±0.2%f.s.	←	←
5k to 10kHz	±0.2%rdg.±0.4%f.s.	←	←
10k to 20kHz	±1.0%f.s.	←	←
20k to 50kHz	±2.5%f.s.	←	←
50k to 100kHz	±10.0%f.s.	←	←

### Assured Accuracy Range for Input Frequency of the 9600

9601 and 9602 each have assured ranges for input frequency.

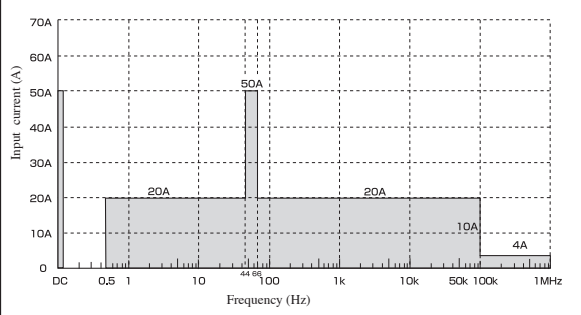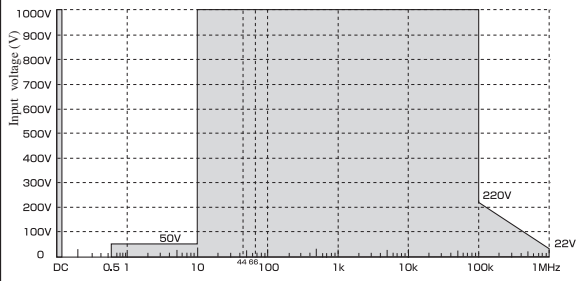

Note 1: Assured accuracy ranges for different response settings are as follows: FAST (0.1 sec) to DC and greater than 50 Hz, MID (0.8 sec) to DC and greater than 10 Hz, SLOW (5.0 sec) to DC or greater than 0.5 Hz

Note 2: Assured accuracy ranges for combined mode measurement are 10 Hz or greater for the AC mode, and DC only for the AC+DC mode or DC mode.

### Calculation algorithm (Indicated only for single phase, 2 wire and 3 phase, 3 wire (3V3A). Two additional calculation algorithms can be selected for apparent/reactive power)

	Voltage	Current	Active power	Apparent power	Reactive power	Power factor	Phase
1φ2W	U <sub>1</sub>	I <sub>1</sub>	P <sub>1</sub>	S <sub>1</sub> =U <sub>1</sub> XI <sub>1</sub>	Q <sub>1</sub> =s <sub>1</sub> ·(U <sub>1</sub> I <sub>1</sub> ) <sup>2</sup> -P <sub>1</sub> <sup>2</sup>	λ <sub>1</sub> =s <sub>1</sub> ·P <sub>1</sub> /S <sub>1</sub>	φ <sub>1</sub> =s <sub>1</sub> ·cos <sup>-1</sup>  λ <sub>1</sub>
SUM	3φ3W (3V3A) U <sub>1,2,3</sub> = U <sub>1</sub> +U <sub>2</sub> +U <sub>3</sub> 3	I <sub>1,2,3</sub> = I <sub>1</sub> +I <sub>2</sub> +I <sub>3</sub> 3	P <sub>1,2,3</sub> =P <sub>1</sub> +P <sub>2</sub>	S <sub>1,2,3</sub> = √3(U <sub>1</sub> +U <sub>2</sub> +U <sub>3</sub> )I <sub>1,2,3</sub>	Q <sub>1,2,3</sub> = s <sub>1</sub> √((U <sub>1</sub> ) <sup>2</sup> -P <sub>1</sub> <sup>2</sup> +s <sub>2</sub> √((U <sub>2</sub> ) <sup>2</sup> -P <sub>2</sub> <sup>2</sup> )	λ <sub>1,2,3</sub> =su  P <sub>1,2,3</sub> /S <sub>1,2,3</sub>	φ <sub>1,2,3</sub> =su cos <sup>-1</sup>  λ <sub>1,2,3</sub>

Note 1: The above calculation algorithm is for a single phase, 2 wire input to ch 1, and 3 phase, 3 wire input to ch 1/2/3 (3 voltage, 3 current).

Note 2: The "s" before each power factor or phase operation indicates the lead or lag of current phase in relation to voltage. The "-" sign means current phase leads voltage and when there is no symbol, it lags. "su" is "-" when the sum of reactive power is negative and "+" (but unsigned) when it is positive.

## Basic specifications

**Measurement line** : Single phase 2 wire, single phase 3 wire, 3 phase 3 wire (3V3A is possible), 3 phase 4 wire

**Measurement item** : When using **9600, 9601, 9602** (optional)

Voltage, current, voltage/current peak, effective/reactive/apparent power, power factor, phase, frequency, current/power integration, load rate, efficiency.

When using the **9603** (optional)

Voltage, torque, r/min, frequency, motor output.

When using the **9605** (optional)

Harmonic, waveform, voltage fluctuation / flicker measurement function.

**Display indication range** : At the lowest range in the DC mode of Models **9600 & 9602**: 0.2% to 130%  
At the lowest range in the AC+DC mode of Models **9600 & 9602**: 0.5% to 130%  
At the 200mA range of Model **9601**: 0.5% to 130%

At 0.1% to 130% of all other ranges.

All range is zero suppressed at less than lower % value.

Valid input range for voltage, current, and power is 0.5% to 110%

**Display** : 6.4 inch TFT color LCD (640 × 480 dot)

**Display resolution** : 99999 count (except with integration), 9999999 count (with integration)

**Rectification method** : Switchable between RMS (true root mean square value) and MEAN (average rectified RMS indication). When combined mode DC is selected, its not possible to switch between them.

**Display update rate** : 8 times/sec.

**Combined mode** : DC, AC + DC, AC (AC only when used in combination with **9601** or **9602** + AC clamp-on sensor)

**Analog response time** : FAST (0.1 sec.), MID (0.8 sec.), SLOW (5.0 sec.)  
(Time required for stabilization to within ±1% when input is changed from 0% to 90%, or 100% to 10% of range.)

**Low pass filter** : OFF / 500Hz / 5kHz / 300kHz (-3dB) For 9601, 5k / 300kHz not available.

**Polarity detection regulation filter** : OFF / 200Hz (-3dB)

**Analog output** : Voltage / current / active power  
DC ±5V f.s (1000V range is DC ±3.333 V f.s.)

**Monitor output** : Voltage / current: 1Vrms f.s. (1000V range is 0.6667 Vrms f.s.)

### [Voltage/ Current/ Active power measurement]

**Measurement range** : See Page 5 specifications for individual input units

### [Integration measurement]

**Number of measurements** : 64 times/sec

**Measurement range** : 0 to ±9999999 TAh / TWh (integration time up to 10,000 hours)

### [Power factor/ Phase angle measurement]

**Measurement range** : -1.0000 (lead) to 0.0000 to 1.0000 (lag)  
-180°(lead) to 0.00° to 180.00°(lag)

### [Frequency measurement]

**Number of channels** : Max. 3ch (selection of voltage or current for arbitrary channel)

**Effective input range** : 0.5 Hz to 2 MHz

**Measurement range** : Auto / 50Hz / 500Hz / 50 kHz / 2 MHz

### [Wave peak measurement]

**Measurement items** : Select either voltage or current for each unit (Shows absolute value of max.)

**Effective Input Range** : Effective value of sine wave is within effective input permissible in the range

## Measurement accuracy (23°C±5°C (73°F±9°F), Less than 80% rh, warm up time greater than 1 hour, sine wave input, power factor = 1, in-phase voltage = 0)

**V, A, W** : Per accuracy table on page 5

**Apparent / reactive power** : ±1 dgt. with respect to calculation from measured value (U, I, P) sum value is max. ±3dgt.

**Integration** : ±1dgt with respect to values calculated from measurements (I, P)

**Power factor** : Max. ±3dgt with respect to values calculated from measurements (U, I, P)

**Phase angle** : Max. ±3dgt with respect to values calculated from measurements (U, I, P)

**Frequency** : ±0.1% rdg. ±1 dgt. (0°C to 40°C(32°F to 104°F), for sine wave input between 10% to 130% of U/I range)

**Wave peak** : ±1% (at 0.5Hz to 1kHz), ±2% (at 1kHz to 10kHz), ±10% (at 10kHz to 100kHz)

## General Specifications

**Location for use** : Indoors, altitude to 2000 m

**Ambient use humidity** : Power meter, 0°C to 40°C (32°F to 104°F), rh below 80% (no condensation)  
When using FDD / printer, 5°C to 40°C (41°F to 104°F), rh below 80%

**Ambient storage humidity** : -10°C to 50°C (14°F to 122°F), rh below 80% and no condensation

**Insulation resistance** : More than 100MΩ from DC500V  
Greater than 50MΩ (at DC500V between U/I input terminal and unit case, between U/I input terminal and power supply plug (for the **9600/9601**), between U input terminal and clamp input terminal, between U input terminal and unit case, and between U input terminal and power supply plug (for **9602**))

**Withstand voltage** : AC5.55kV between U/I terminal and unit case, between U/I terminal and power supply plug (for **9600** and **9601**), between U terminal and clamp input terminal, between U terminal and unit case, between U input terminal and power supply plug (for **9602**)

**[Motor output (Pm) measured]** **9603** (optional) external input unit required

**Measurement method** : Digital calculation from measured voltage or pulse signal  
Effective when **9603** ch A is torque (any of N/m, mN/m, kN/m, kgf/m, kgf/cm), and ch B is r/min

**Display indication range** : 0.1% to 130% of **9603** voltage range (polarity not indicated)

**Calculation algorithm** : Set to required format

### [Efficiency measurement]

**Calculable factors** : Maximum of 3 formats

**Calculated items** : P for each input unit, Pm when combined with **9603** (Items measured with **9605** not allowed)

### [D/A output]

**Number of channels** : 8ch (12 bit D/A converter polarity + 11bit)

**Output impedance** : 100Ω±5%

**Output items** : Outputs 8 arbitrarily selected items

**Output voltage** : DC±5V/f.s.

**Output update rate** : 16 times/sec

### [FDD]

**Compatible media** : 3.5-inch, 2HD (1.2MB/1.44MB)

**Format** : MS-DOS

**Functions** : Function for saving and loading settings, and saving measured values. Function for outputting measured values. Floppy disk formatting function, file renaming and deleting

### [Interface]

**GP-IB** : Conforms to IEEE-488.1 1987, with reference to IEEE-488.2 1987

**RS-232C** : Start-stop synchronous, with baud rate of 2400 or 9600 bits/sec

### [External Control]

**Functions** : Integration start / stop control, Integration data reset, External A/D (For display update when power meter display is in hold mode), Manual print control, FD save control

**Control signal level** : From 0 / 5V logic signal or short/open contact signal

### [Other functions]

**Scaling** : PT/CT ratio Set range 0.0001 to 10000

**Averaging** : Time average (set interval time, timer time, and average of realtime control time)

Moving average (number of samples: 8/16/32/64)

Exponential average (attenuation factor: 8/16/32/64)

Multilingual display : Japanese/English screen display switching

Set time (all types) : Interval control time (10 sec to 100 hours) in 10 sec increments

(When used in combination with FDD or printer, auto select increments)

Timer control time (1 min to 10000 hours) in 1 minute increments

Realtime control time, 1 minute increments

### [Harmonic / Flicker measurement] **9605** (optional) required

**Measurement item** : See Page 4 specifications for **9605**

**Motor output** : ±1dgt for calculations of each measured value

**Efficiency** : Max. ±7 dgt with respect to values calculated from measurements of items substituted into algorithm

**Thermal coefficient** : Within ±0.03% f.s./ °C

**Effect of in-phase voltage** : Within ±0.05% f.s.

(1000 Vrms, 50/60Hz, between shorted voltage input terminals and case)

**Effect of power factor** : ±0.15% f.s. (power factor = 0)

**Actual time** : ±25ppm ±1dgt. (0 to 40°C (73°F to 104°F))

**D/A output** : Display accuracy - ±0.2% f.s.

**Analog output** : Display accuracy - ±0.2% f.s.

**Monitor output** : Display accuracy - ±0.2% f.s. (less than 100kHz)

Display accuracy - ±3dB (100k to 1MHz)

**Certifications** : Safety

EN61010

: EMC

EN61326

EN61000-3-2

EN61000-3-3

**Power supply** : AC100V/120V/200V/230V (switched automatically), 50/60Hz

**Maximum rated power** : 150VA max.

**Dimensions, mass** : Approx 430 W × 150 H × 370 D mm, Approx 13 kg

(Approx 16.93"(W) × 5.91"(H) × 14.57"(D), Approx 458.6 oz.)

(in configuration including **9600** 5 ch, **9603, 9604**)


(Not including projections such as terminals, feet, and handles)

**Accessories** : Power cord 1, ground adapter (3P to 2P) 1, connector 1



## CLAMP-ON SENSOR(Optional) Specifications

To use the Clamp-On sensor, be sure to order the factory option **9602** AC/DC Clamp Input Unit.

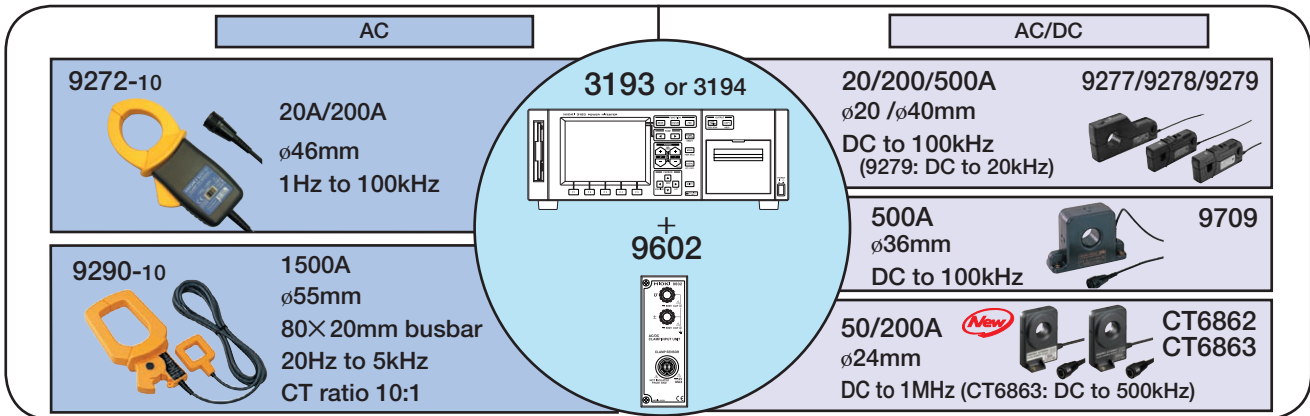

Model	* 9272-10	9277	9278	9279	* 9709	** CT6862	* CT6863
Rated current	20/200A AC	20A AC/DC	200A AC/DC	500A AC/DC	500A AC/DC	50A AC/DC	200A AC/DC
Accuracy 23°C±3°C, 45 to 66Hz (73°F±5.4°F)	±0.3%rdg.±0.01%f.s. (vibration amplitude) ±0.2°max.(phase)	After degaussing and warming up for at least 30 minutes: ±0.5%rdg±0.05%f.s.(vibration amplitude) ±0.2°max.(phase, DC not specified)		DC to 1kHz: ±1.0%max. 1kHz to 10kHz: ±2.5%max. 10kHz to 20kHz: ±5.0%max.	Warming up for at least 10 minutes: ±0.5%rdg±0.01%f.s.(vibration amplitude) ±0.2°max.(phase, DC not specified)	Warming up for at least 5 minutes: ±0.5%rdg±0.05%f.s.(vibration amplitude) ±0.2°max.(phase, DC not specified)	
Frequency characteristics (vibration amplitude, phase) (deviation from the basic accuracy)	1Hz to 5kHz: ±2.1%max. To 10kHz: ±2.6%max. To 100kHz: ±30.1%max.	DC to 1kHz: ±1.0%max. 1kHz to 50kHz: ±2.5%max. 50kHz to 100kHz: ±5.0%max.		DC to 1kHz: ±1.0%max. 1kHz to 10kHz: ±2.5%max. 10kHz to 20kHz: ±5.0%max.	DC to 45Hz: ±0.2%max. To 10kHz: ±2.0%max. To 100kHz: ±30%max.	DC to 16Hz: ±0.1%max. To 100kHz: ±2.0%max. To 1MHz: ±30%max.	DC to 16Hz: ±0.1%max. To 100kHz: ±5.0%max. To 1MHz: ±30%max.

\*For further details, please refer to the individual product catalog for the instrument.


\*\*A version update of the 3193/3194 may be required.

### Ordering information

**POWER HiTESTER 3193** (main unit only)

**MOTOR / HARMONIC HiTESTER 3194** (main unit only)

Measurements cannot be taken with a **POWER HiTESTER 3193** and **MOTOR / HARMONIC HiTESTER 3194** unit only. A factory option input unit must be purchased.

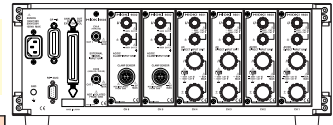

	1ch	2ch	3ch	4ch	5ch	6ch
Pattern A	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )
Pattern B	1 ∅ 3W / 3 ∅ 3W ( ×2)	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )
Pattern C	1 ∅ 3W / 3 ∅ 3W ( ×2)	1 ∅ 3W / 3 ∅ 3W ( ×2)	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )
Pattern D	1 ∅ 3W / 3 ∅ 3W ( ×2)	1 ∅ 3W / 3 ∅ 3W ( ×2)	1 ∅ 3W / 3 ∅ 3W ( ×2)	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )
Pattern E	3V3A (3 ∅ 3W) / 3 ∅ 4W ( ×3)	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )
Pattern F	3V3A (3 ∅ 3W) / 3 ∅ 4W ( ×3)	1 ∅ 3W / 3 ∅ 3W ( ×2)	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )	1 ∅ 2W ( )
Pattern G	3V3A (3 ∅ 3W) / 3 ∅ 4W ( ×3)	3V3A (3 ∅ 3W) / 3 ∅ 4W ( ×3)	3V3A (3 ∅ 3W) / 3 ∅ 4W ( ×3)	3V3A (3 ∅ 3W) / 3 ∅ 4W ( ×3)	3V3A (3 ∅ 3W) / 3 ∅ 4W ( ×3)	3V3A (3 ∅ 3W) / 3 ∅ 4W ( ×3)

( ) : 9600, 9601, 9602 can be selected.

#### Notes on input unit selection

- Use the same input unit for a particular measurement line.
- Install units in succession starting from channel 1.
- For the 9603 or 9603-01, only one unit can be installed.
- When the 9602 is selected, use an optional clamp-on sensor.

#### Options that can be installed at the factory

(specify at time of order)

AC/DC DIRECT INPUT UNIT 9600

AC DIRECT INPUT UNIT 9601

AC/DC CLAMP INPUT UNIT 9602

EXTERNAL SIGNAL INPUT UNIT 9603 (3193 only)

EXTERNAL SIGNAL INPUT UNIT 9603-01 (3194 only)

PRINTER UNIT 9604

HARMONIC / FLICKER MEASUREMENTS UNIT 9605  
(3193 only)

\*Voltage cables are not supplied. Also, please contact your **HIOKI** distributor for clip type leads or other special needs.

#### Options

CLAMP ON SENSOR 9272-10 (20/200A AC)

UNIVERSAL CLAMP ON CT 9277 (20A AC/DC)

UNIVERSAL CLAMP ON CT 9278 (200A AC/DC)

\* UNIVERSAL CLAMP ON CT 9279 (500A AC/DC)

AC/DC CURRENT SENSOR 9709 (500A AC/DC)

AC/DC CURRENT SENSOR CT6862 (50A AC/DC)

AC/DC CURRENT SENSOR CT6863 (200A AC/DC)

CLAMP ON ADAPTER 9290-10 (1500A AC, ratio10:1)

RECORDING PAPER 9232 (10 m, 10 roll, For 9604)

\*No CE marking

# HIOKI

HIOKI E. E. CORPORATION

#### HEAD OFFICE :

81 Koizumi, Ueda, Nagano, 386-1192, Japan  
TEL +81-268-28-0562 / FAX +81-268-28-0568  
E-mail: os-com@hioki.co.jp

#### HIOKI USA CORPORATION :

6 Corporate Drive, Cranbury, NJ 08512 USA  
TEL +1-609-409-9109 / FAX +1-609-409-9108  
E-mail: hioki@hiokiusa.com

HIOKI (Shanghai) Sales & Trading Co., Ltd. :  
1608-1610 Shanghai Times Square Office, 93 Huai Hai Zhong  
Road, Shanghai, P.R.China POSTCODE: 200021  
TEL +86-21-6391-0090/0092 FAX +86-21-6391-0360  
E-mail: info-sh@hioki.com.cn

#### Beijing Office :

A-2602 Freetown, 58 Dong San Huan Nan Road  
Beijing, P.R.China POSTCODE: 100022  
TEL +86-10-5867-4080/4081 FAX +86-10-5867-4090  
E-mail: info-bj@hioki.com.cn

#### Guangzhou Office :

Room A-3206, Victory Plaza Services Center, No.103,  
Tiyuxi Road, Guangzhou, P.R.China POSTCODE: 510620  
TEL +86-20-38392673/2676 FAX +86-20-38392679  
E-mail: info-gz@hioki.com.cn

DISTRIBUTED BY