

HIOKI

CLAMP ON AC/DC HiTESTER

3288 [1000 Arms max. MEAN Value]

3287 [100 A max. True RMS]

Field Measuring Instrument



Compact & Easy

With Guaranteed Accuracy!

AC/DC Multi-Function Clamp

3288

AC/DC
1000A
max.

**Economically
priced**



ISO 9001
JMI-0216



ISO14001
JQA-E-90091

Actual-size



3287
AC/DC
100A
max

One-touch maintenance on all types of AC/DC equipment

Features

- The 3288, for high current measurements such as UPS emergency batteries and train motors:

Handles measurements up to a maximum of AC/DC 1000 A, using an average value type measurement formula for AC mode to realize cost savings.



- The 3287, which can handle even cogenerator / inverter energy-saving equipment:

The 3287 performs accurate measurements of even small currents in the AC/DC 10.00 A range. In AC mode it also guarantees accuracy of true RMS measurements for frequencies from 10 Hz to 1 kHz. Handles low frequency to distorted currents including higher harmonics, simplifying maintenance of energy-saving equipment up to a maximum of 100 A.



- Multi-function clamp that simplifies equipment diagnosis:
Besides AC/DC current measurement, it also contains DMM functions for voltage, resistance, and continuity checking.

3287/3288 Specifications (accuracy at 23°C±5°C (73°F±9°F), 80% rh)


Function	Range (Accuracy)
DC current ^{*1}	3288 100.0 / 1000 A (±1.5%rdg ±5dgt.)
	3287 10.00 / 100.0 A (±1.5%rdg ±5dgt.)
AC current ^{*1}	3288 100.0 / 1000 A (45 to 66 Hz; ±1.5%rdg ±5dgt.) (10 to 45 Hz or 66Hz to 500Hz; ±2.0%rdg ±5dgt.)
	3287 10.00 / 100.0 A (45 to 66 Hz; ±1.5%rdg ±5dgt.) (10Hz to 20Hz; ±5.0%rdg ±5dgt., 20 to 45 Hz or 66Hz to 1kHz; ±2.0%rdg ±5dgt.)
DC voltage	420.0 m / 4.200 / 42.00 / 420.0 / 600 V (±1.3%rdg ±4dgt.)
AC voltage	4.200 / 42.00 / 420.0 / 600 V (30 to 500Hz; ±2.3%rdg ±8dgt.)
Resistance (open terminal voltage 3.4 V max. ^{*2})	420.0 / 4.200 k / 42.00 k / 420.0k / 4.200 M / 42.00 MΩ (±2.0%rdg ±4dgt. ^{*3})
Continuity (open terminal voltage 3.4 V max.)	420.0 Ω (±2.0%rdg ±6dgt.) (Buzzer sounds at approx. 50 Ω or less)

*1. current measurement function performs zero suppression for counts 5 or less

*2. at 420 Ω (4.2k 0.7V typ.) 42k to 42M 0.5V (typ.)


*3. at 420 to 420kΩ (4.2MΩ ±5.0%rdg ±4dgt. 42MΩ ±10.0%rdg ±4dgt.)

Inspect the unit and check that it is operating correctly before use. When carrying out measurement on live lines, wear proper protective gear, insulating rubber gloves, insulating rubber boots and safety helmet, and use extreme caution to avoid electric shock accidents. In order to prevent short-circuits and injury, use the clamp product on electrical circuits with a voltage less than the maximum operation circuit voltage.

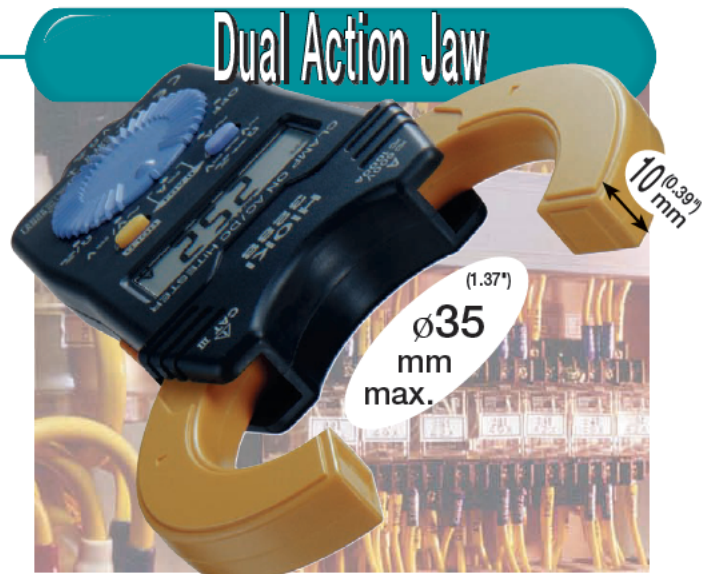

- A slim core of only 10 mm (0.39"), so clamping is easy even in crowded wiring
- Independent-opening double-lever design
- No metal (iron core) exposure, ensuring enhanced safety
- CAT III 600 V (current) for emphasis on safety

- Test Lead Holder for convenient voltage, resistance, and continuity checking.

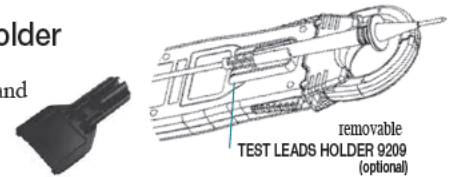

●AC measurement: 3287; true RMS, 3288; MEAN value ●Ancillary functions: auto zero(at DCA), auto ranging, data hold function, auto power save function ●Display: Max.4199-count LCD ●Sampling rate: 2.5 times/sec ●Measurable conductor diameter: $\phi 35$ mm (1.37") max. ●Max.usable circuit voltage: 600Vrms ●Crest factor(3287 only): 2.5 or less (150Amax. 1000Vmax.) ●Effect of conductor position: within ± 1.0 % (3288; ± 2.0 %) in any direction from the center of sensor ●Overload protection: DCV/ACV - 600 V DC /AC rms; ohms/continuity - 250 V DC /AC rms ●Applicable standards: Safety - EN61010 CAT III 600V(AC A), CAT III 300V(AC/DC V), CAT II 600V(AC/DC V), UL 61010B; EMC - EN61326 ●Location for use: Indoors, altitude up to 2000 m ●Ambient temperature of use: 0 to 40°C (32°F to 104°F), 80%rh (no condensation) ●Storage temperature range: -10 to 50°C (14°F to 122°F), (no condensation) ●Power source: CR 2032 battery×1 (3V DC) ●Continuous operating time: approx. 25 hours (3288; approx. 60 hours) ●Dimensions and mass: Approx. 57 W×180 H×16 D mm, 170 g (3288; 150 g) (Approx 2.2" (W)×7.1" (H)×0.6" (D), 6.0 oz. (3288; 5.3oz.))

- Accessories: battery, carrying case, test leads and manual



Includes TEST LEADS 9208 and CARRYING CASE 9398