Operation and Service Manual

Keysight 85130C NMD 3.5 mm to Type-N Adapter Kit



# **Notices**

© Keysight Technologies, Inc. 1987-2017

No part of this manual may be reproduced in any form or by any means (including electronic storage and retrieval or translation into a foreign language) without prior agreement and written consent from Keysight Technologies, Inc. as governed by United States and international copyright laws.

### Trademark Acknowledgments

#### Manual Part Number

85130-90010

#### **Edition**

Edition 2, April 2017 Printed in USA/Malaysia

Published by: Keysight Technologies 1400 Fountaingrove Parkway Santa Rosa, CA 95403

## Warranty

THE MATERIAL CONTAINED IN THIS DOCUMENT IS PROVIDED "AS IS." AND IS SUBJECT TO BEING CHANGED, WITHOUT NOTICE, IN FUTURE EDITIONS. FURTHER, TO THE MAXIMUM EXTENT PERMITTED BY APPLICABLE LAW, KEYSIGHT DISCLAIMS ALL WARRANTIES. EITHER EXPRESS OR IMPLIED WITH REGARD TO THIS MANUAL AND ANY INFORMATION CONTAINED HEREIN, INCLUDING BUT NOT LIMITED TO THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE. KEYSIGHT SHALL NOT BE LIABLE FOR ERRORS OR FOR INCIDENTAL OR CONSEQUENTIAL DAMAGES IN CONNECTION WITH THE FURNISHING, USE, OR PERFORMANCE OF THIS DOCUMENT OR ANY INFORMATION CONTAINED HEREIN. SHOULD KEYSIGHT AND THE USER HAVE A SEPARATE WRITTEN AGREEMENT WITH WARRANTY TERMS COVERING THE MATERIAL IN THIS

DOCUMENT THAT CONFLICT WITH THESE TERMS, THE WARRANTY TERMS IN THE SEPARATE AGREEMENT WILL CONTROL.

### **Technology Licenses**

The hardware and/or software described in this document are furnished under a license and may be used or copied only in accordance with the terms of such license.

### U.S. Government Rights

The Software is "commercial computer software," as defined by Federal Acquisition Regulation ("FAR") 2.101. Pursuant to FAR 12.212 and 27.405-3 and Department of Defense FAR Supplement ("DFARS") 227.7202, the U.S. government acquires commercial computer software under the same terms by which the software is customarily provided to the public. Accordingly, Keysight provides the Software to U.S. government customers under its standard commercial license, which is embodied in its End User License Agreement (EULA), a copy of which can be found at http://www.keysight.com/find/sweula The license set forth in the EULA represents the exclusive authority by which the U.S. government may use, modify, distribute, or disclose the Software. The EULA and the license set forth therein. does not require or permit, among other things, that Keysight: (1) Furnish technical information related to commercial computer software or commercial computer software documentation that is not customarily provided to the public; or (2) Relinquish to, or otherwise provide, the government rights in excess of these rights customarily provided to the public to use, modify, reproduce, release, perform, display, or disclose commercial computer software or commercial computer software

documentation. No additional

government requirements beyond those set forth in the EULA shall apply, except to the extent that those terms, rights, or licenses are explicitly required from all providers of commercial computer software pursuant to the FAR and the DFARS and are set forth specifically in writing elsewhere in the EULA. Keysight shall be under no obligation to update, revise or otherwise modify the Software. With respect to any technical data as defined by FAR 2.101, pursuant to FAR 12.211 and 27.404.2 and DFARS 227.7102, the U.S. government acquires no greater than Limited Rights as defined in FAR 27.401 or DFAR 227.7103-5 (c), as applicable in any technical data.

# Safety Notices

### CAUTION

A CAUTION notice denotes a hazard. It calls attention to an operating procedure, practice, or the like that, if not correctly performed or adhered to, could result in damage to the product or loss of important data. Do not proceed beyond a CAUTION notice until the indicated conditions are fully understood and met.

#### WARNING

A WARNING notice denotes a hazard. It calls attention to an operating procedure, practice, or the like that, if not correctly performed or adhered to, could result in personal injury or death. Do not proceed beyond a WARNING notice until the indicated conditions are fully understood and met.

# 85130C Adapter Kit

## General Information

To obtain optimum performance from this adapter kit, observe these simple precautions:

- Make connections carefully to avoid misalignment and connector damage, which will result in inaccurate measurements.
- Keep the connectors free of dirt and any particles.
- When you clean the connectors, try using compressed air first. Do not use abrasives. With a clean foam swab, apply only isopropyl alcohol.
- For more information, refer to the Connector Care for RF and Microwave Coaxial Connectors document. It can be viewed online by searching for part number 08510-90064 at www.keysight.com.

# Description

The 85130C adapters are used when type-N devices must be attached to a 3.5 mm test set in a network analyzer system. The test set end of the adapters has a NMD-3.5 mm (f) connector while the Device Under Test (DUT) end has a precision slotless type-N connector (PSC-N).

#### Contents

The 85130C kit contains the following:

- Test port adapter, NMD-3.5 mm (f) to PSC-N (m) (Keysight part number 85054-60030)
- Test port adapter, NMD-3.5 mm (f) to PSC-N (f) (Keysight part number 85054-60029)
- Storage box, foam-lined
- Operating and Service Manual
- Spanner wrench

# Specifications

Keysight Technologies guarantees that your adapters will equal or exceed the following specifications in the  $+20^{\circ}$  to  $+26^{\circ}$ C ( $+68^{\circ}$  to  $+79^{\circ}$ F) temperature range.

Frequency	Return Loss
DC – 8 GHz	≥ 34 dB
8 – 18 GHz	≥ 28 dB

The allowable recession of the center conductor of the NMD-3.5 mm (f) connector is -0.0006 to -0.0022 inches (-0.015 to -0.056 mm) below the mating surface of the outer conductor.

The allowable pin position for type-N connectors is:

```
male = -0.2075 to -0.2079 inch (-5.2705 to -5.28066 mm)
female = +0.2061 to +0.2065 inch (+5.23494 to +5.2451 mm)
```

In a mated pair of type-N connectors, the center conductor's mating plane is offset from the outer conductor's mating plane by 0.207 inch (5.2578 mm) in the direction of the male connector. See Figure 1 on page 3.

Zero the gages before each use by attaching the appropriate gage master to the end of the gage, torquing the connection to 12 in-lb with a 3/4 inch torque wrench, and adjusting the dial on the face of the gage so the gage reads zero.

Both type-N gages, male and female, read zero when the center conductor to outer conductor offset is nominally 0.2070 inch (5.2578 mm).


When gaging a male connector, the actual recession of the center conductor is -0.2070 inch plus the reading on the gage.

When gaging a female connector, the actual recession of the center conductor is +0.2070 inch plus the reading on the gage.

Example: for a gage reading of -0.0001 inch, the following is true:

Gage Reading	Actual Pin Positions (versus outer mating plane)			
	Male	Female		
-0.0001 inch	-0.2070 + (-0.0001) = -0.2071 inch	+0.2070 + (-0.0001) = +0.2069 inch		

Figure 1 Type-N Connectors

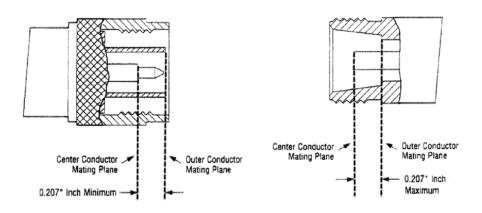

<sup>°</sup>The gage calibration blocks are manufactured to 0.2072 inches for the male and 0.2068 inches for the female. This takes into consideration the uncertainty of  $\pm 0.0002$  inches ( $\pm 0.005$  mm) of the gage and its calibration block. Manufacturing the gages blocks this way insures that the center conductors of two mated type-N devices will never have an interference fit between them.

85130 010 001

# Proper Use


Attach the adapters to the test ports and tighten them finger tight. Use the spanner wrench to hold the test set end of the adapter and torque the test set connector with a 20 mm torque wrench set to 96 N-cm (8 in-lb).

#### Performance Tests

Use a network analyzer to perform the following return loss test on your adapters as soon as you receive them. Periodically repeat the test to determine if the performance meets the electrical specifications on the previous page, or if they need to be replaced. An initial period of one year between performance tests is recommended.

Required Equipment	Keysight Model or Part Number
Network analyzer – 18 GHz (or higher) measurement capability – with time domain option 010	PNA with Option 010 (See PNA Family Microwave Network Analyzers Configuration Guide, part number 5990-7745EN)
Type-N loads (included in the 85054B calibration kit)	00909-60011 (male) 00909-60012 (female)
Type-N 50 ohm airline, 12.5 cm (included in the 85055A verification kit)	85055-60001

Figure 2 Return Loss Setup

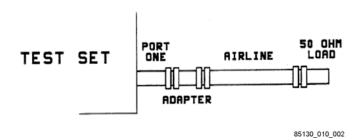

Return loss is measured by connecting a 50 ohm fixed load termination through a 12.5 cm airline to the adapter, then attaching the adapter to port one of the test set (see Figure 2).

The effects of an imperfect load may be gated out using the network analyzer time domain option.


NOTE

Refer to your network analyzer's Help system for specific instructions on using the functions mentioned in the return loss test below.

- 1. Preset the analyzer.
- **2.** Set a stimulus start frequency of the analyzer's lowest frequency.
- **3.** Set a stimulus stop frequency of 18 GHz.

- 4. Set an IF bandwidth of 100 Hz.
- 5. Perform, and then save, a 3.5 mm 1-port S11 calibration.
- **6.** With correction turned on, select the time domain mode.
- 7. Set a stimulus start time for the sweep to -0.05 nano-seconds.
- 8. Set a stimulus stop time for the sweep to 1.9 nano-seconds.
- 9. Select the gating function and gate-out everything but the adapter. See Figure 2.
- 10. Select the analyzer's frequency domain mode.
- 11. Use the markers to read the return loss value.

Figure 3 Analyzer Trace Showing Location of Gates and Airline

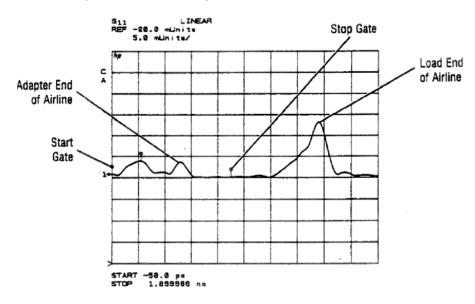

85130\_010\_003

## Performance Test Record

ELECTRICAL SPECIFICATIONS					
Tested by: Date:					
Adapter	Frequency Range	Return Loss	Measured		
NMD-3.5 mm (f) to PSC-N (m)	DC to 8 GHz	≥ 34 dB			
and NMD-3.5 mm (f) to PSC-N (f)	8 GHz to 18 GHz	≥ 28 dB			

## 85130C Adapter Kit

# Replaceable Parts

There are no replaceable components for the adapters. A worn or damaged adapter must be replaced in whole.

# Equipment and Supplies

The following equipment and supplies are required for the maintenance and use of, but are not supplied with, your 85130C adapter. kit.

Item	Part Number
3.5 mm gage kit (part of the 85052B calibration kits)	85052-80010
Type-N gage kit (part of the 85054B calibration kit)	85054-80011
Torque wrench, 3/4", 136 N-cm (12 in-lb) (part of the 85054B calibration kit)	8710-1766
Torque wrench, 20 mm, 96 N-cm (8 in-lb)	8710-1764
Document: Connector Care for RF and Microwave Coaxial Connectors	08510-90064

# Contacting Keysight

Assistance with test and measurement needs and information on finding a local Keysight office are available on the Web at:

## www.keysight.com/find/assist



In any correspondence or telephone conversation, refer to the Keysight product by its model number and full serial number. With this information, the Keysight representative can determine whether your product is still within its warranty period.



This information is subject to change without notice.

© Keysight Technologies 1987-2017

Edition 2, April 2017



www.keysight.com